


PURMO C 33

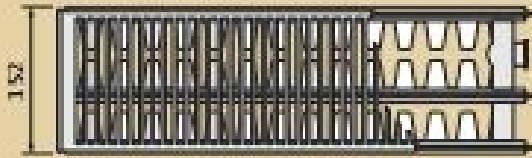

LUNGIME (mm)	parametry $t_1 / t_2 / t_3$	IN ALTE [mm]					
		300	450	500	550	600	900
400	75/65/20 °C	539	748	814	879	942	1304
	70/55/20 °C	431	596	649	700	750	1035
500	75/65/20 °C	674	935	1018	1099	1178	1630
	70/55/20 °C	539	746	811	875	937	1294
600	75/65/20 °C	808	1121	1221	1318	1414	1956
	70/55/20 °C	647	895	973	1050	1124	1553
700	75/65/20 °C	943	1308	1425	1538	1649	2282
	70/55/20 °C	754	1044	1135	1225	1312	1812
800	75/65/20 °C	1078	1495	1628	1758	1885	2608
	70/55/20 °C	862	1193	1298	1399	1499	2071
900	75/65/20 °C	1212	1682	1832	1977	2120	2934
	70/55/20 °C	970	1342	1460	1574	1687	2329
1000	75/65/20 °C	1347	1869	2035	2197	2356	3260
	70/55/20 °C	1078	1491	1622	1749	1874	2588
1100	75/65/20 °C	1482	2056	2239	2417	2592	3586
	70/55/20 °C	1186	1640	1784	1924	2061	2847
1200	75/65/20 °C	1616	2243	2442	2636	2827	3912
	70/55/20 °C	1293	1789	1946	2099	2249	3106
1400	75/65/20 °C	1886	2617	2849	3076	3298	4564
	70/55/20 °C	1509	2087	2271	2449	2624	3623
1600	75/65/20 °C	2155	2990	3256	3515	3770	5216
	70/55/20 °C	1724	2386	2595	2799	2999	4141
1800	75/65/20 °C	2425	3364	3663	3955	4241	5868
	70/55/20 °C	1940	2684	2919	3149	3373	4659
2000	75/65/20 °C	2694	3738	4070	4394	4712	6520
	70/55/20 °C	2156	2982	3244	3499	3748	5176
2300	75/65/20 °C	3098	4299	4681	5053	5419	7498
	70/55/20 °C	2479	3429	3730	4023	4310	5953
2600	75/65/20 °C	3502	4859	5291	5712	6126	8476
	70/55/20 °C	2802	3877	4217	4548	4873	6729
3000	75/65/20 °C	4041	5607	6105	6591	7068	9780
	70/55/20 °C	3233	4473	4866	5248	5622	7764